

Serie »click-clock«

Betriebstemperatur:


Betriebsdruck:

Gewinde:

-20 °C bis +70 °C

bis 16 bar - abhängig vom Druckbereich des eingesetzten Schlauches


G-Gewinde nach DIN EN ISO 228-1

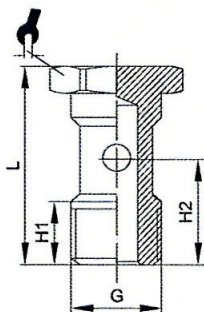

762.018

Hohlschraube, einfach

Artikel-Nr.	G	H1	H2	L	SW
762.005	M5	6,0	9,6	17,5	8
762.018	G 1/8	9,0	15,0	28,0	14
762.014	G 1/4	12,0	18,0	33,0	17
762.038	G 3/8	13,0	21,0	36,0	19

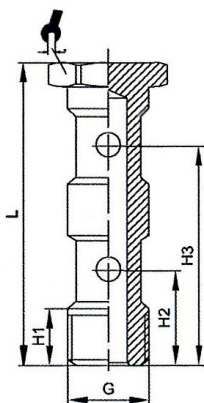

763.018

Hohlschraube, zweifach

Artikel-Nr.	G	H1	H2	H3	L	SW
763.018	G 1/8	9,0	15,0	31,0	44,5	14
763.014	G 1/4	11,0	17,0	36,0	51,5	17
763.038	G 3/8	14,0	20,5	43,0	58,1	19

Abteilung ZeDok


Tel. 07125/949741, 949742, 949753

Fax. 07125/949799

e-mail: zedok@riegler.de

Ausgabe 06/2011 Technische Änderungen vorbehalten.


Riegler & Co. KG, Druckluft-Armaturen

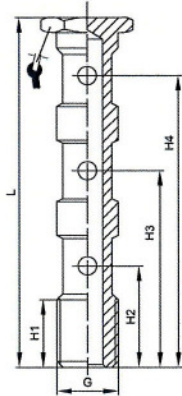

764.018

Hohlschraube, dreifach


Artikel-Nr.	G	H1	H2	H3	H4	L	SW
764.018	G 1/8	9,0	16,0	32,5	48,0	60,0	14
764.014	G 1/4	12,0	18,5	37,0	55,5	70,5	17
764.038	G 3/8	13,0	20,5	44,0	65,0	80,0	19

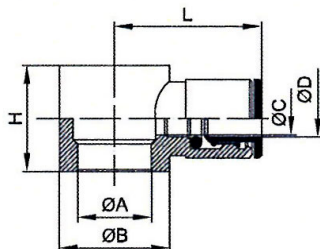

765.018-4

Ringstück, einfach

Artikel-Nr.	ØD	G	ØA	ØB	ØC	H	L
765.005-4	4	M5	5,0	SW9	3,0	9,0	18,0
765.018-4	4	G 1/8	9,9	14,0	3,0	15,0	20,5
765.018-6	6	G 1/8	9,9	14,0	5,0	15,0	23,0
765.018-8	8	G 1/8	9,9	14,0	6,0	15,0	24,5
765.014-6	6	G 1/4	13,3	18,0	5,0	17,0	24,0
765.014-8	8	G 1/4	13,3	18,0	7,0	17,0	26,0
765.014-10	10	G 1/4	13,3	18,0	9,0	17,0	27,0
765.014-12	12	G 1/4	13,3	18,0	9,0	17,0	28,0
765.038-8	8	G 3/8	16,6	21,0	7,0	20,0	27,0
765.038-10	10	G 3/8	16,6	21,0	9,0	20,0	28,0
765.038-12	12	G 3/8	16,6	21,0	11,0	20,0	29,0

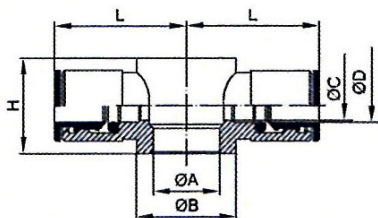

766.018-4

Ringstück, zweifach

Artikel-Nr.	ØD	G	ØA	ØB	ØC	H	L
766.005-4	4	M5	5,0	7,0	3,0	9,0	18,0
766.018-4	4	G 1/8	9,9	14,0	3,0	15,0	21,0
766.018-6	6	G 1/8	9,9	14,0	5,0	15,0	23,0
766.018-8	8	G 1/8	9,9	14,0	6,0	15,0	24,5
766.014-6	6	G 1/4	13,3	18,0	5,0	17,0	24,0
766.014-8	8	G 1/4	13,3	18,0	7,0	17,0	26,0
766.014-10	10	G 1/4	13,3	18,0	9,0	17,0	26,0
766.038-8	8	G 3/8	16,7	21,0	7,0	20,0	27,0
766.038-10	10	G 3/8	16,7	21,0	9,0	20,0	28,0
766.038-12	12	G 3/8	16,7	21,0	11,0	20,0	29,0